## DIGITAL TRAVEL FLOOR DRIVE

AL aluminum
CM composite matrix
CNC machined
digital strip gauge
air bleed system
threaded connection

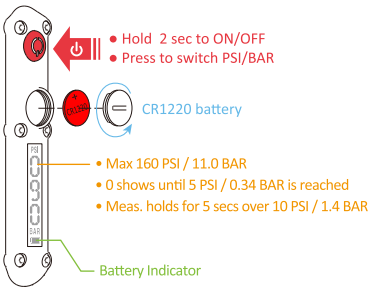
• Hold 2 sec to ON/OFF
• Press to switch PSI/BAR
CR1220 battery
• Max 160 PSI / 11.0 BAR
• 0 shows until 5 PSI / 0.34 BAR is reached
• Meas. holds for 5 secs over 10 PSI / 1.4 BAR
Battery Indicator

**To reset the gauge:**
TURN THE PUMP ON FIRST, then press and hold the power button for 10 seconds.
The gauge will turn off and on during this process, do not let go of the button until the gauge turns on again.

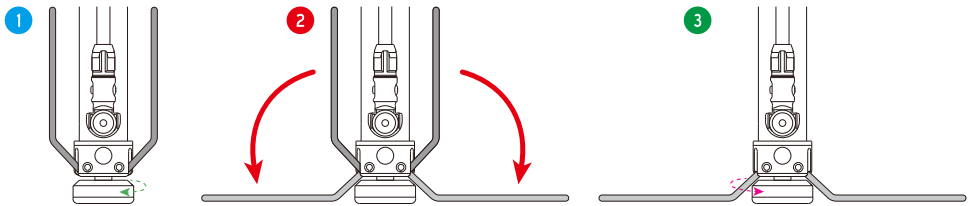


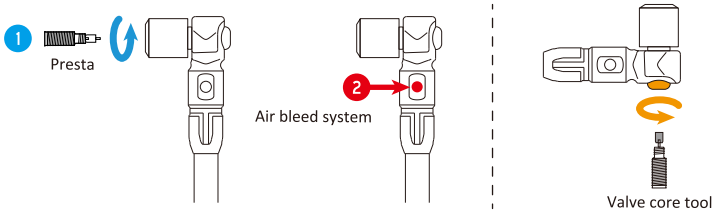


For more info go to: www.lezyne.com/support.php